

Heya table assembly





Table of contents

Desk height conference table assembly	3
Bar height conference table assembly	4
Bar height runoff table assembly	5-6



Heya desk height table assembly:

Tools required:

- Cordless drill

1. This sheet covers the necessary steps to fully assemble a Heya desk height freestanding table.
2. Begin by placing the table legs onto the back side of the worksurface. Rotate the legs in the orientation shown in the view above, making sure the holes on the mount plate align with the pre-drilled holes on the worksurface.
3. With the legs positioned correctly, fasten each mount plate to the worksurface using the supplied (1608904) #12 X 7/8" screws.

Table leg orientation

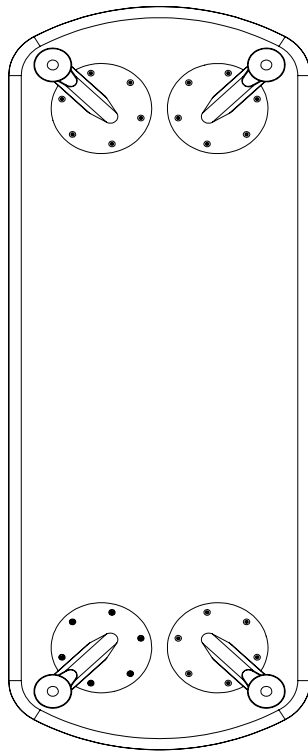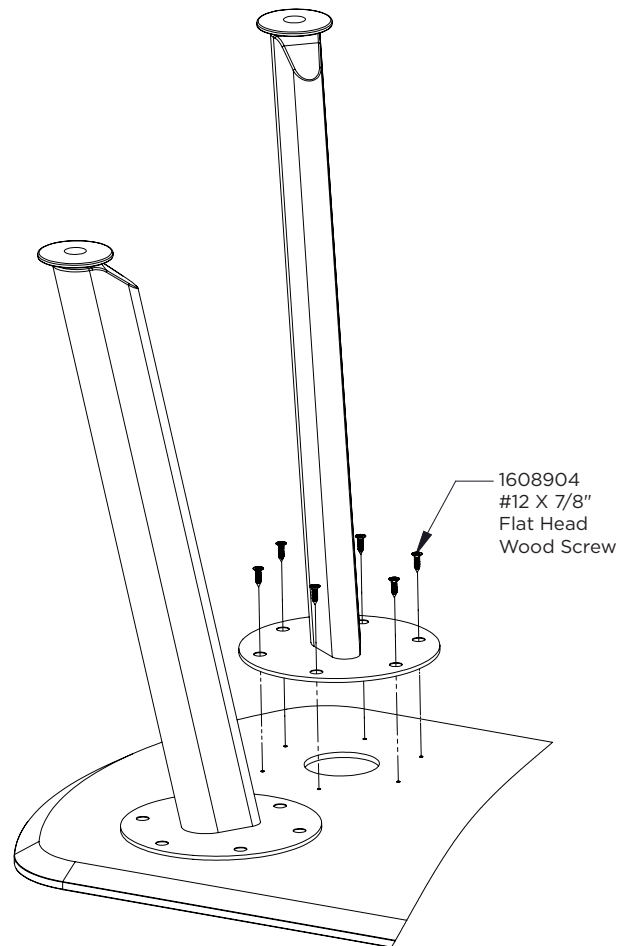


Heya bar height table assembly:

Tools required:

- Cordless drill
- 5/32" Allen wrench
- 1/4" Allen wrench

1. This sheet covers the necessary steps to fully assemble a Heya bar height freestanding table.
2. Begin by inserting the (1609755) 5/16-18 X 2" screw into the foot rail knuckle and threading into the table leg, making sure the knuckle has been mounted in the same orientation as shown in the view above. Do not fully tighten the screw at this time. Repeat this step for all remaining table legs.
3. Next, slip the shortest length foot rail over one end of the knuckle. Align the mounting holes between the knuckle and foot rail and fasten the (1609077) 1/4-20 X 5/8" screws down. Slip the remaining open end of the foot rail over the end of the knuckle on another table leg and fasten down completely as shown in the view above. Repeat this step for the remaining foot rail and table legs.
4. Position one pair of legs onto the worksurface making sure the holes on the mount plate align with the pre-drilled holes on the worksurface. Fasten the mount plates to the worksurface using the supplied (1608904) #12 X 7/8" screws.
5. The longest length foot rails can now be slipped over the ends of the knuckles of the mounted table legs. The remaining pair of table legs can then be inserted into the opposing ends of the foot rails. Once again, align the holes between the foot rails and knuckles, then fasten down using the (1609077) screws. Fasten the remaining mount plates down to the worksurface, and lastly, fully tighten the (4) knuckle screws from the first step.

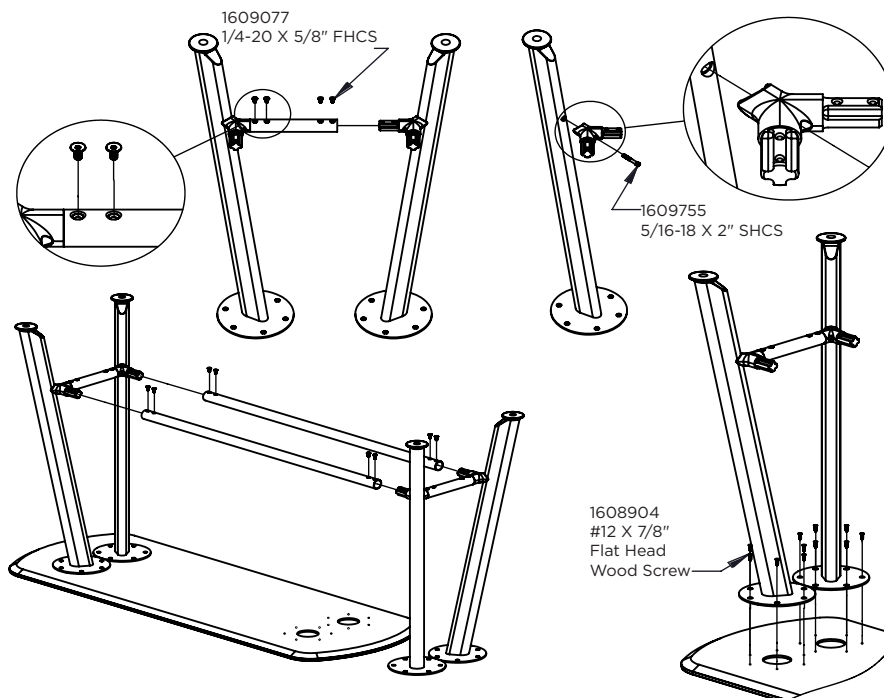


Heya bar height runoff table assembly:

Tools required:

- Cordless drill
- 5/32" Allen wrench
- 3/16" Allen wrench
- 1/4" Allen wrench

This sheet covers the necessary steps to fully assemble a Heya bar height runoff table.

1. Begin by inserting the (1609755) 5/16-18 X 2" screw into the foot rail knuckle and threading into the table leg, making sure the knuckle has been mounted in the same orientation as shown in the view above. Repeat this step for the remaining table leg.
2. Next, slip the shortest length foot rail over one end of the knuckle. Align the mounting holes between the knuckle and foot rail and fasten the (1609077) 1/4-20 X 5/8" screws down. Slip the remaining open end of the foot rail over the end of the knuckle on another table leg and fasten down completely as shown in the view above.
3. Position the pair of legs onto the worksurface making sure the holes on the mount plate align with the pre-drilled holes on the worksurface. Fasten the mount plates to the worksurface using the supplied (1608904) #12 X 7/8" screws.

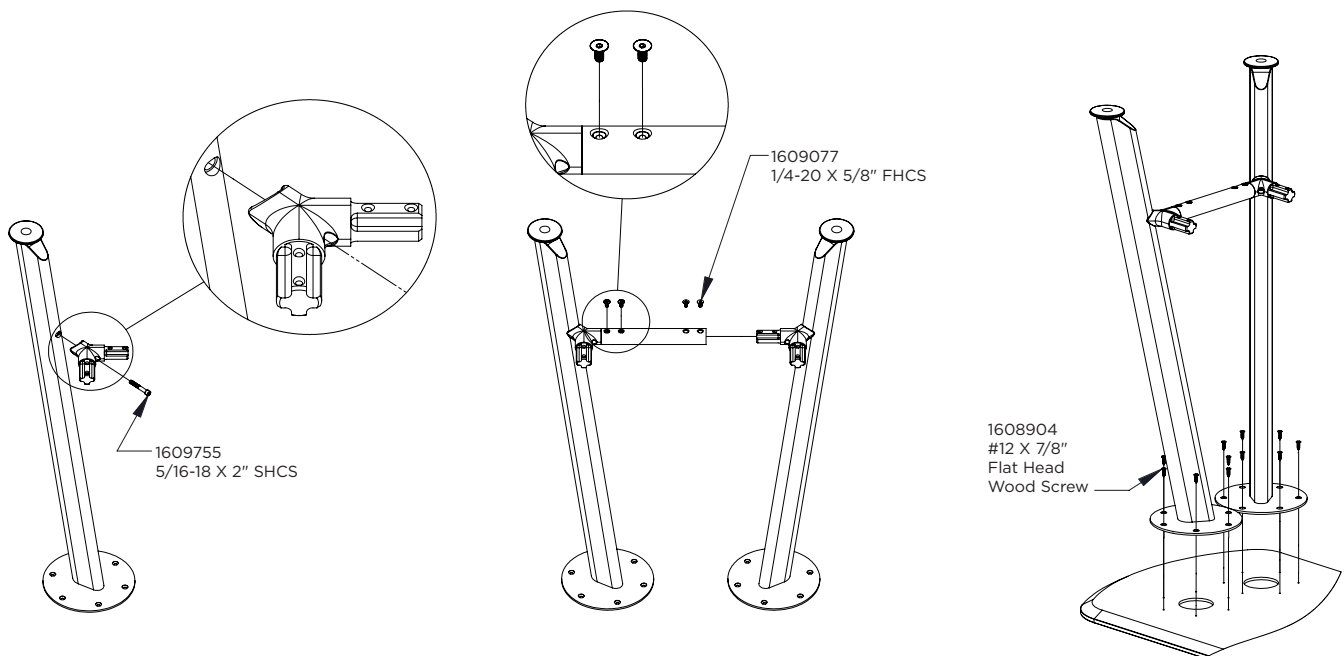

Heya bar height table runoff table assembly continued:

4. Using the view above, fasten the table bracket to the media screen using the supplied 1/4-20 machine screws. Next, insert the (1609756) 1/4-20 X 1.5" screw into the mount puck and thread into the corresponding hole on the media screen. Making sure the threaded holes on the mount puck are located in the six o'clock position, tighten the screw down completely.
5. The table assembly can now be flipped over and rested onto the table bracket. Have the table slid away from the screen far enough such that the longer foot rails can be slipped over the mount pucks. The table can then be shifted back towards the screen so that the knuckles on the table legs are inserted into the foot rails. Align the holes between the foot rails and knuckles/mount pucks, then fasten down using the (1609077) 1/4-20 X 5/8" screws. Lastly, fasten the table top down to the table bracket using the supplied (1413679) 1/4-20 X .75" screws as shown in the view above.

