


September 2023

[illegible]

■ **Uniframe Tables - Parts Diagram**
Rectangular Tables with Seats Wheelchair Accessible - WAUF 12

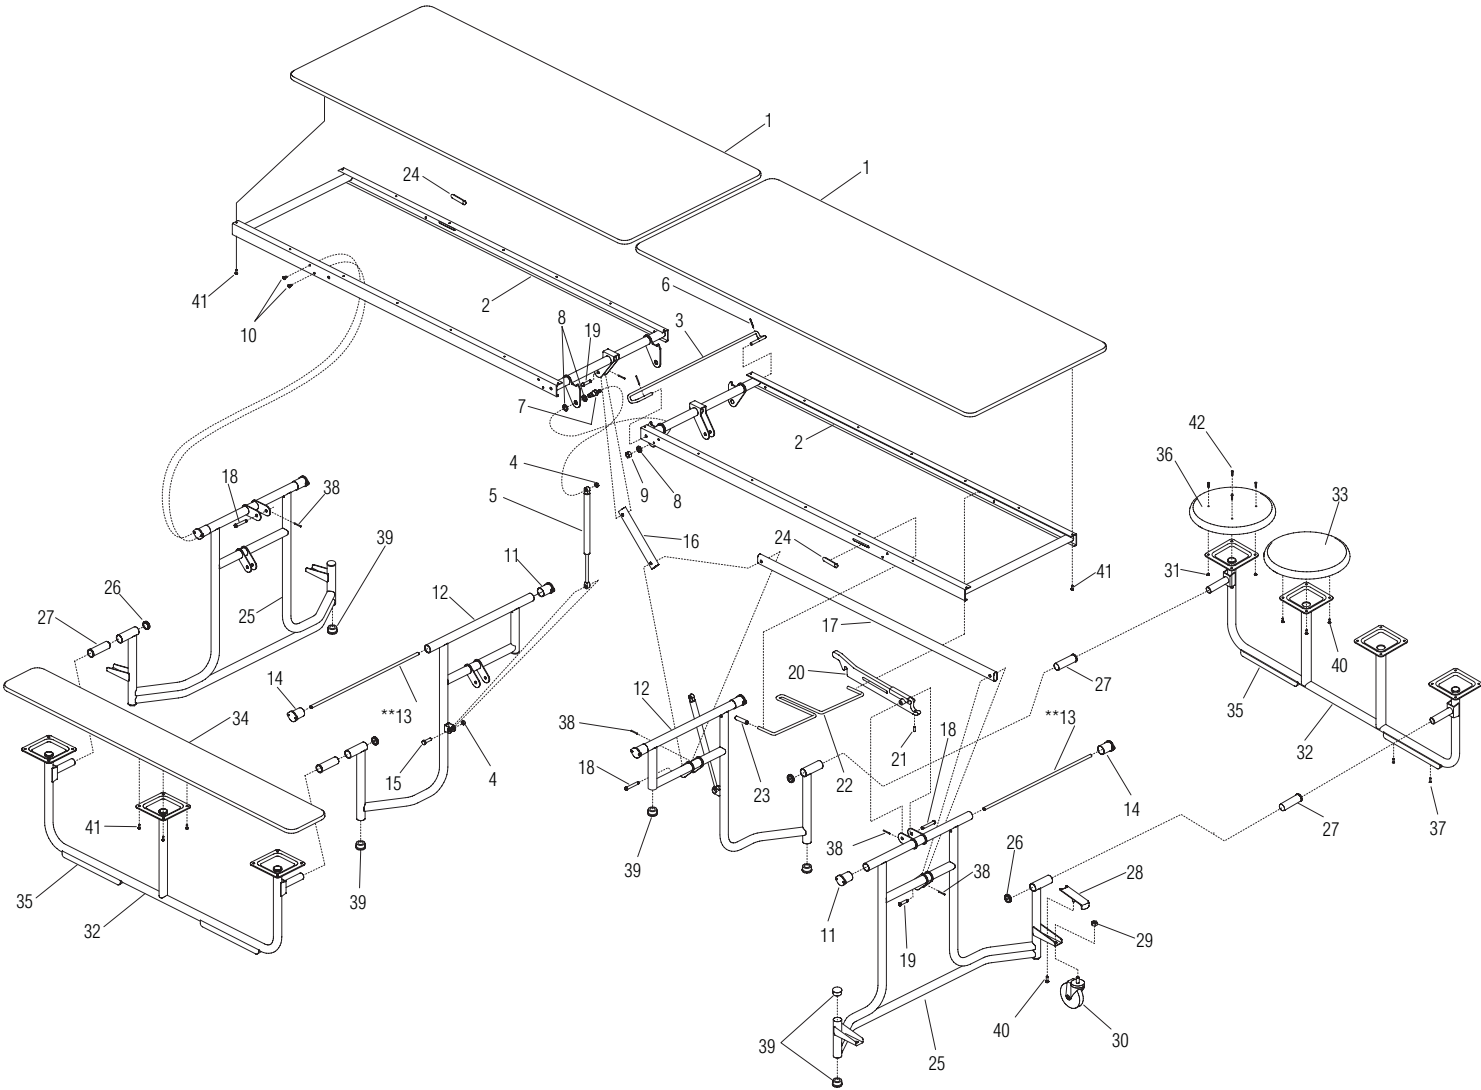

Item 43 = Replacement Frame

Uniframe Tables - Parts Diagram ■ Rectangular Tables with Seats Wheelchair Accessible - WAUF 12


When ordering specify laminate color and edge style.

“.XX” = Select Color & “.XXX” = Select Color

** = WAUF12 (12' table) uses (4) Torsion Bars (1) in all support weldments

Item	Part Number	Item Description	Req Qty
1	UFATO	Table Top, 30 x 72" Bullnose	2
		Table Top, 30 x 72" Perfect Edge	2
		Table Top, 30 x 72" 73P Edge	2
2	37.3307.12.BLX	Apron Weldment, 12'	2
3	37.3337.CH.X	Down Lock	1
4	12.1153.X	Nut, Center Lock, 3/8"	4
5	37.3353.X	Pneumatic Cylinder 75# force	2
6	12.1943.X	Roll Pin, 1/8 x 1 1/4"	2
7	37.3360.X	Center Pivot	2
8	12.2700.X	Washer, Thrust	6
9	12.7000.X	Flange Lock Nut, 1/2-13	2
10	49.1612.PX	Screw, 1/4-20 x 5/8" Serrated Hex Head	16
11	37.3332.BL.X	Pivot Weldment	4
12	37.3320.31C.XXX	Support Weldment, 31", Center	2
13	37.3344.X	Torsion Bar **	4
14	37.3331.BL.X	Torque Flange Weldment	4
15	12.1100.X	Screw, 3/8-16 x 1 1/2" Hex Head Cap	4
16	37.3338.C.BL.X	Center Linkage	2
17	37.3338.12.O.BL	Outside Linkage, 12'	2
18	12.2703.X	Clevis Pin, 3/8 x 2 1/2"	4
19	12.2704.X	Clevis Pin, 3/8 x 1 1/2"	4
20	37.3340.BLX	Latch, with Catch	1
21	12.2713.X	Set Screw, 1/4-20 x 1"	1
22	37.3404.CH.X	Latch Actuator Rod	1
23	37.3408.X	Actuator Rod End Cap	2
24	37.3405.X	Slot Plug	2
25	37.3320.31O.XXX	Support Weldment, 31", Outside	2
26	10.1009.X	Dbl Clip Tube Closure	4
27	37.3336.BL.X	Bushing, Seat Pivot	4
28	37.3398.X	Cover, Caster Bracket	4
29	12.2711.X	Nut, 7/16-14 Center Lock	4
30	09.1022.X	4" Caster, 5/8" Stem	4
31	12.0023.TM.X	Hex Head Nut w/lock washer, #10-24 (hard plastic stool only), 4-Pole	32
		Hex Head Nut w/lock washer, #10-24 (hard plastic stool only), 3-Pole	24
32	37.3312.484.LXX	Seat Support Weldment, 48", 4-Supports, Left	2
	37.3312.483.LXX	Seat Support Weldment, 48", 3-Supports, Left	2
33	06.1089.XX	Poly Stool, 4-Pole	8
		Poly Stool, 3-Pole	6
34	UFABE	Bench, 12' Table	2
35	37.3400.X	12" Glide	4
36	06.1005.MBE.DRX	Hard Plastic Stool, Beige #02, 4-Pole	8
		Hard Plastic Stool, Beige #02, 3-Pole	6
	06.1005.CB.DRX	Hard Plastic Stool, Blue #07, 4-Pole	8
		Hard Plastic Stool, Blue #07, 3-Pole	6
	06.1005.CN.DRX	Hard Plastic Stool, Navy #25, 4-Pole	8
		Hard Plastic Stool, Navy #25, 3-Pole	6
	06.1005.CL.DRX	Hard Plastic Stool, Light Grey, #16 4-Pole	8
		Hard Plastic Stool, Light Grey, #16 3-Pole	6
	06.1005.CBLDR.X	Hard Plastic Stool, Black, 4-Pole	8
		Hard Plastic Stool, Black, 3-Pole	6
	06.1005.CR.DRX	Hard Plastic Stool, Cranberry, #13 4-Pole	8
		Hard Plastic Stool, Cranberry, #13 3-Pole	6
37	12.2709.X	Screw, 1/4-20 x 1 1/2" Phillips Flat Head Tapping	8
38	12.1004.TM.X	Roll Pin, 5/32 x 1"	8
39	06.0416.X	Tube Plug, 1 1/4" dia. 14-20ga BL	10
40	12.1200.X	Screw, SMS #14 x 5/8" PPH B P (poly stool only), 4-Pole	32
		Screw, SMS #14 x 5/8" PPH B P (poly stool only), 3-Pole	24
41	12.0039.X	Screw, #10 x 3/4" PH DP Thread	28
42	12.1953.X	3/16 x 1" Carriage Head Bolt (hard plastic stool only), 4-Pole	32
		3/16 x 1" Carriage Head Bolt (hard plastic stool only), 3-Pole	24
43	UFAFR	Replacement Frame (Doesn't include tops, seats or benches. Includes casters, cylinders, glides & aprons.)	1

■ **Uniframe Tables - Parts Diagram**
 Rectangular Tables with Seats - UF

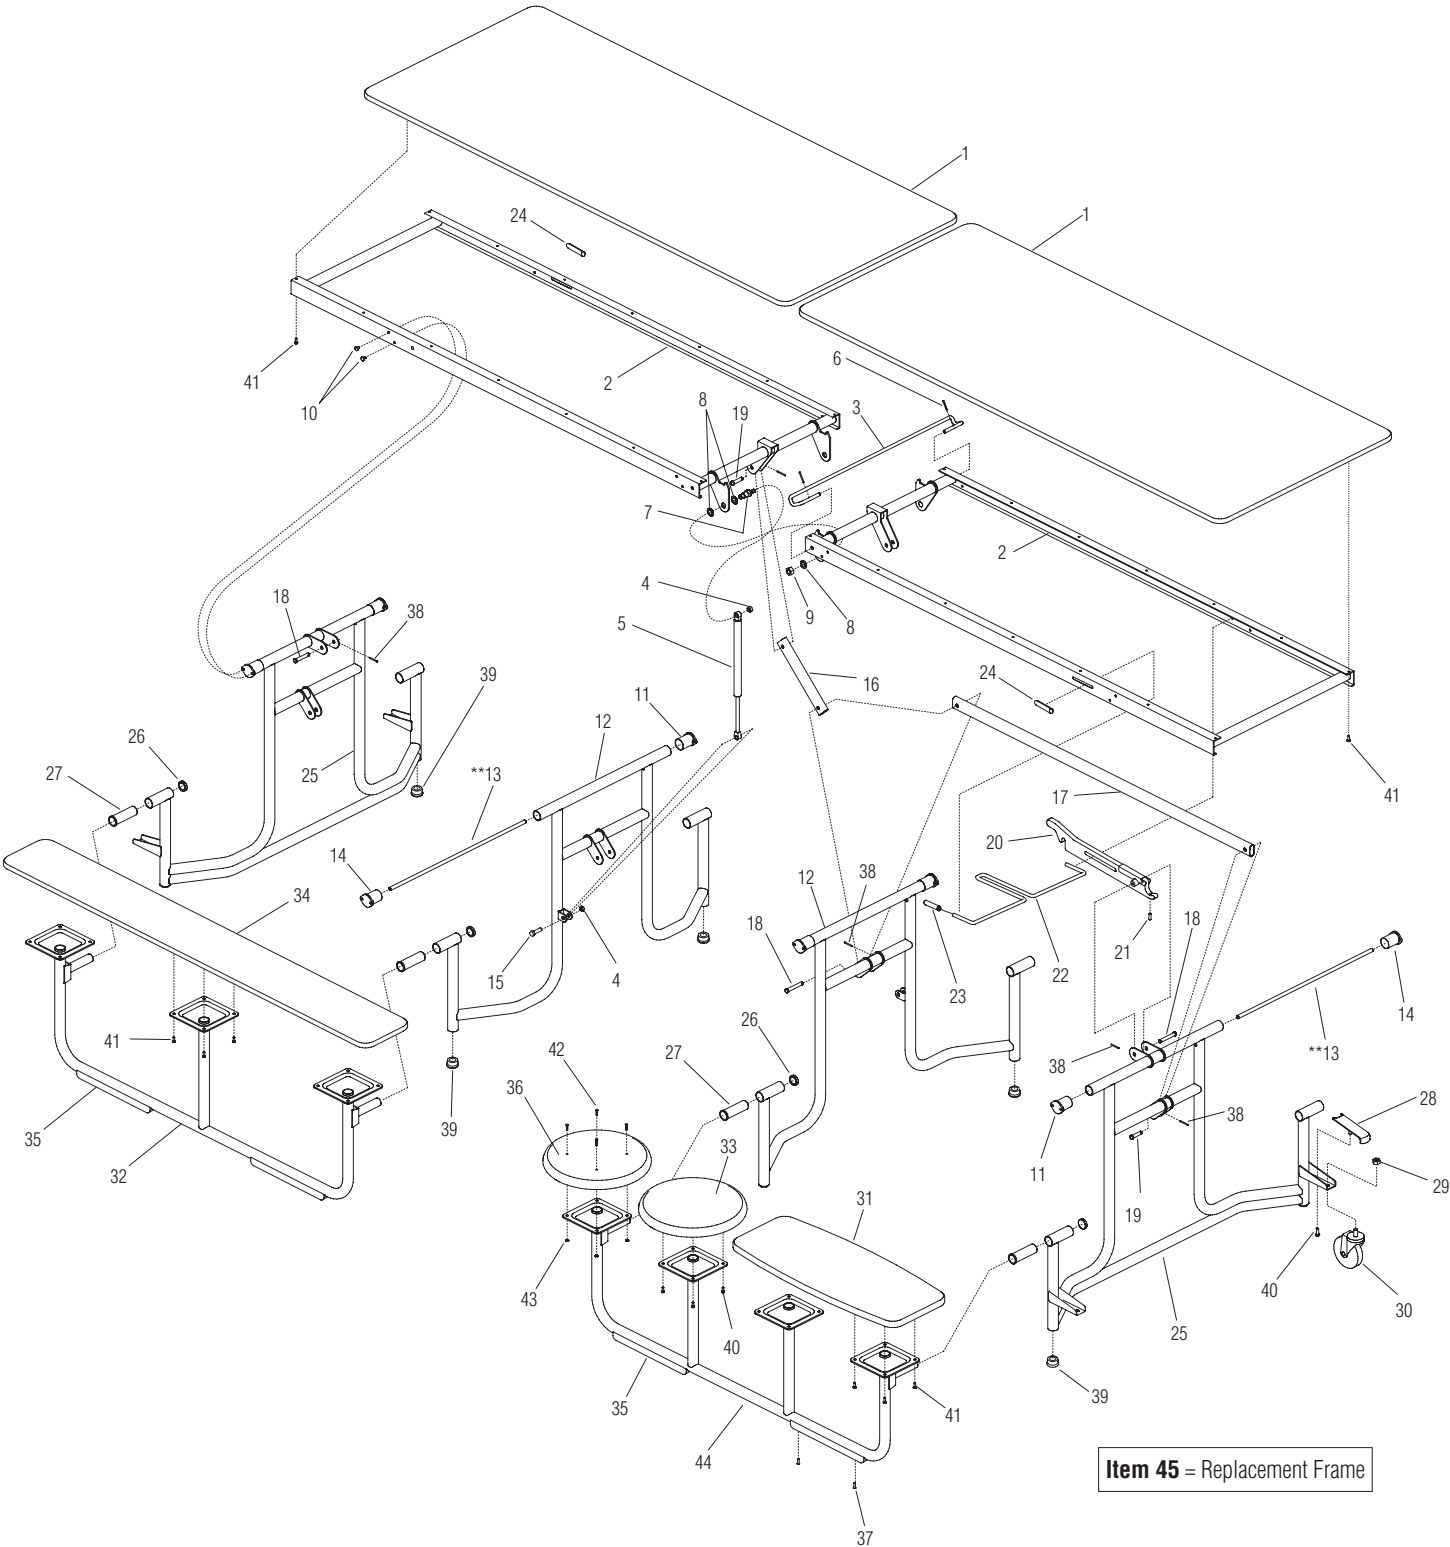

Uniframe Tables - Parts Diagram

Rectangular Tables with Seats - UF

When ordering specify laminate color and edge style.

".XX" = Select Color & ".XXX" = Select Color


** = UF08 (8' table) uses (2) Torsion Bars located in the Outside Support Weldments.

UF10 (10' table) uses (3) Torsion Bars, (1) located in a Center and (2) Outer support weldments.

UF12 (12' table) uses (4) Torsion Bars (1) in all Support weldments.

Item	Part Number	Item Description	Req Qty	Item	Part Number	Item Description	Req Qty
1	UFATO	Table Top, 30 x 48" Bullnose	2	32	37.3312.484.LXX	Seat Support Weldment, 48", 4-Supports, Left, UF12	2
		Table Top, 30 x 48" Perfect Edge	2		37.3312.483.LXX	Seat Support Weldment, 48", 3-Supports, Left, UF12	2
		Table Top, 30 x 48" 73P Edge	2		37.3312.403.LXX	Seat Support Weldment, 40", 3-Supports, Left, UF10	2
		Table Top, 30 x 60" Bullnose	2		37.3312.302.LXX	Seat Support Weldment, 30", 2-Supports, Left, UF08	2
		Table Top, 30 x 60" Perfect Edge	2				
		Table Top, 30 x 60" 73P Edge	2	33	06.1089.XX	Poly Stool, 3-Pole	12
		Table Top, 30 x 72" Bullnose	2			Poly Stool, 4-Pole	16
		Table Top, 30 x 72" Perfect Edge	2	34	UFABE	Bench, 8' Table, 3-Pole	12
		Table Top, 30 x 72" 73P Edge	2			Bench, 8' Table, 4-Pole	16
2	37.3307.12.BLX	Apron Weldment, 12'	2			Bench, 10' Table, 3-Pole	12
	37.3307.10.BLX	Apron Weldment, 10'	2			Bench, 10' Table, 4-Pole	16
	37.3307.8.BLX	Apron Weldment, 8'	2			Bench, 12' Table, 3-Pole	12
3	37.3337.CH.X	Down Lock	1			Bench, 12' Table, 4-Pole	16
4	12.1153.X	Nut, Center Lock, 3/8"	4				
5	37.3351.X	Pneumatic Cylinder, 225# Force (UF12/8/CX)	2	35	37.3400.X	12" Glide	8
	37.3352.X	Pneumatic Cylinder, 202# Force (UF12/6/CX, UF12/8/PY, UF12/SB, UF12/BE)	2	36	06.1005.MBE.DRX	Hard Plastic Stool, Beige #02, 4-Pole	16
	37.3353.X	Pneumatic Cylinder, 75# Force (WAUF12, UF08)	2		06.1005.CB.DRX	Hard Plastic Stool, Beige #02, 3-Pole	12
	37.3354.X	Pneumatic Cylinder, 175# Force (UF10, UF12/6/PY)	2		06.1005.CN.DRX	Hard Plastic Stool, Blue #07, 4-Pole	16
6	12.1943.X	Roll Pin, 1/8 x 1 1/4"	2		06.1005.CN.DRX	Hard Plastic Stool, Blue #07, 3-Pole	12
7	37.3360.X	Center Pivot	2		06.1005.CL.DRX	Hard Plastic Stool, Navy #25, 4-Pole	16
8	12.2700.X	Washer, Thrust	6		06.1005.CL.DRX	Hard Plastic Stool, Navy #25, 3-Pole	12
9	12.7000.X	Flange Lock Nut, 1/2-13	2		06.1005.CB.DRX	Hard Plastic Stool, Light Grey #16, 4-Pole	16
10	49.1612.P.X	Screw, 1/4-20 x 5/8" Serrated Hex Head	16		06.1005.CB.DRX	Hard Plastic Stool, Light Grey #16, 3-Pole	12
11	37.3332.BL.X	Pivot Weldment, 8'	6		06.1005.CB.DRX	Hard Plastic Stool, Black, 4-Pole	16
		Pivot Weldment, 10'	5		06.1005.CR.DRX	Hard Plastic Stool, Black, 3-Pole	12
		Pivot Weldment, 12'	4		06.1005.CR.DRX	Hard Plastic Stool, Cranberry #13, 4-Pole	16
12	37.3320.27C.XXX	Support Weldment, 27", Center	2			Hard Plastic Stool, Cranberry #13, 3-Pole	12
	37.3320.29C.XXX	Support Weldment, 29", Center	2	37	12.2709.X	Screw, 1/4-20 x 1 1/2" Phillips	16
**13	37.3344.X	Torsion Bar, 8'	2			Flat Head Tapping	8
		Torsion Bar, 10'	3	38	12.1004.TM.X	Roll Pin, 5/32 x 1"	8
		Torsion Bar, 12'	4	39	06.0416.X	Tube Plug, 1 1/4 dia. 14-20ga BL	8
14	37.3331.BL.X	Torque Flange Weldment, 8'	2	40	12.1200.X	Screw, SMS #14 x 5/8" PPH B P (poly stool only), 8/10/12', 3-Pole	96
		Torque Flange Weldment, 10'	3			Screw, SMS #14 x 5/8" PPH B P (poly stool only), 8/10/12', 4-Pole	128
		Torque Flange Weldment, 12'	4			Screw, #10 x 3/4" PH DP Thread, 8'	20
15	12.1100.X	Screw, 3/8-16 x 1 1/2" Hex Head Cap	4	41	12.0039.X	Screw, #10 x 3/4" PH DP Thread, 10'	24
16	37.3338.C.BL.X	Center Linkage	2			Screw, #10 x 3/4" PH DP Thread, 12'	28
17	37.3338.12.O.BL	Outside Linkage, 12'	2	42	12.1953.X	Carriage Head Bolt 3/6 x 1" (hard plastic stool only), 3-Pole	48
	37.3338.10.O.BL	Outside Linkage, 10'	2			Carriage Head Bolt 3/6 x 1" (hard plastic stool only), 4-Pole	64
	37.3338.8.O.BL	Outside Linkage, 8'	2			Hex Head Nut w/lock washer, #10-24 (hard plastic stool only), 3-Pole	48
18	12.2703.X	Clevis Pin, 3/8 x 2 1/2"	4			Hex Head Nut w/lock washer, #10-24 (hard plastic stool only), 4-Pole	68
19	12.2704.X	Clevis Pin, 3/8 x 1 1/2"	4				
20	37.3340.BLX	Latch, with Catch	1	43	12.0023.TM.X	Hex Head Nut w/lock washer, #10-24 (hard plastic stool only), 3-Pole	48
21	12.2713.X	Set Screw, 1/4-20 x 1"	1			Hex Head Nut w/lock washer, #10-24 (hard plastic stool only), 4-Pole	68
22	37.3404.CH.X	Latch Actuator Rod	1				
23	37.3408.X	Actuator Rod End Cap	2	44	37.3312.484.RXX	Seat Support Weldment, 48", 4-Supports, Right, UF12	2
24	37.3405.X	Slot Plug	2		37.3312.483.RXX	Seat Support Weldment, 48", 3-Supports, Right, UF12	2
25	37.3320.27O.XXX	Support Weldment, 27", Outside	2		37.3312.403.RXX	Seat Support Weldment, 40", 3-Supports, Right, UF10	2
	37.3320.29O.XXX	Support Weldment, 29", Outside	2		37.3312.302.RXX	Seat Support Weldment, 30", 2-Supports, Right, UF08	2
26	10.1009.X	Dbt Clip Tube Closure	8			Replacement Frame (Doesn't include tops, seats or benches. Includes casters, cylinders, glides & aprons.)	1
27	37.3336.BL.X	Bushing, Seat Pivot	8	45	UFAFR		
28	37.3398.X	Cover, Caster Bracket	4				
29	12.2711.X	Nut, 7/16-14 Center Lock	4				
30	09.1022.X	4" Caster, 5/8" Stem	4				
31	UFABE	Split Bench, Bullnose	4				
		Split Bench, Perfect Edge	4				
		Split Bench, 73P Edge	4				

■ **Uniframe Tables - Parts Diagram**
 Round Table with Seats - UFRD 5/8, UFRD 5/SB

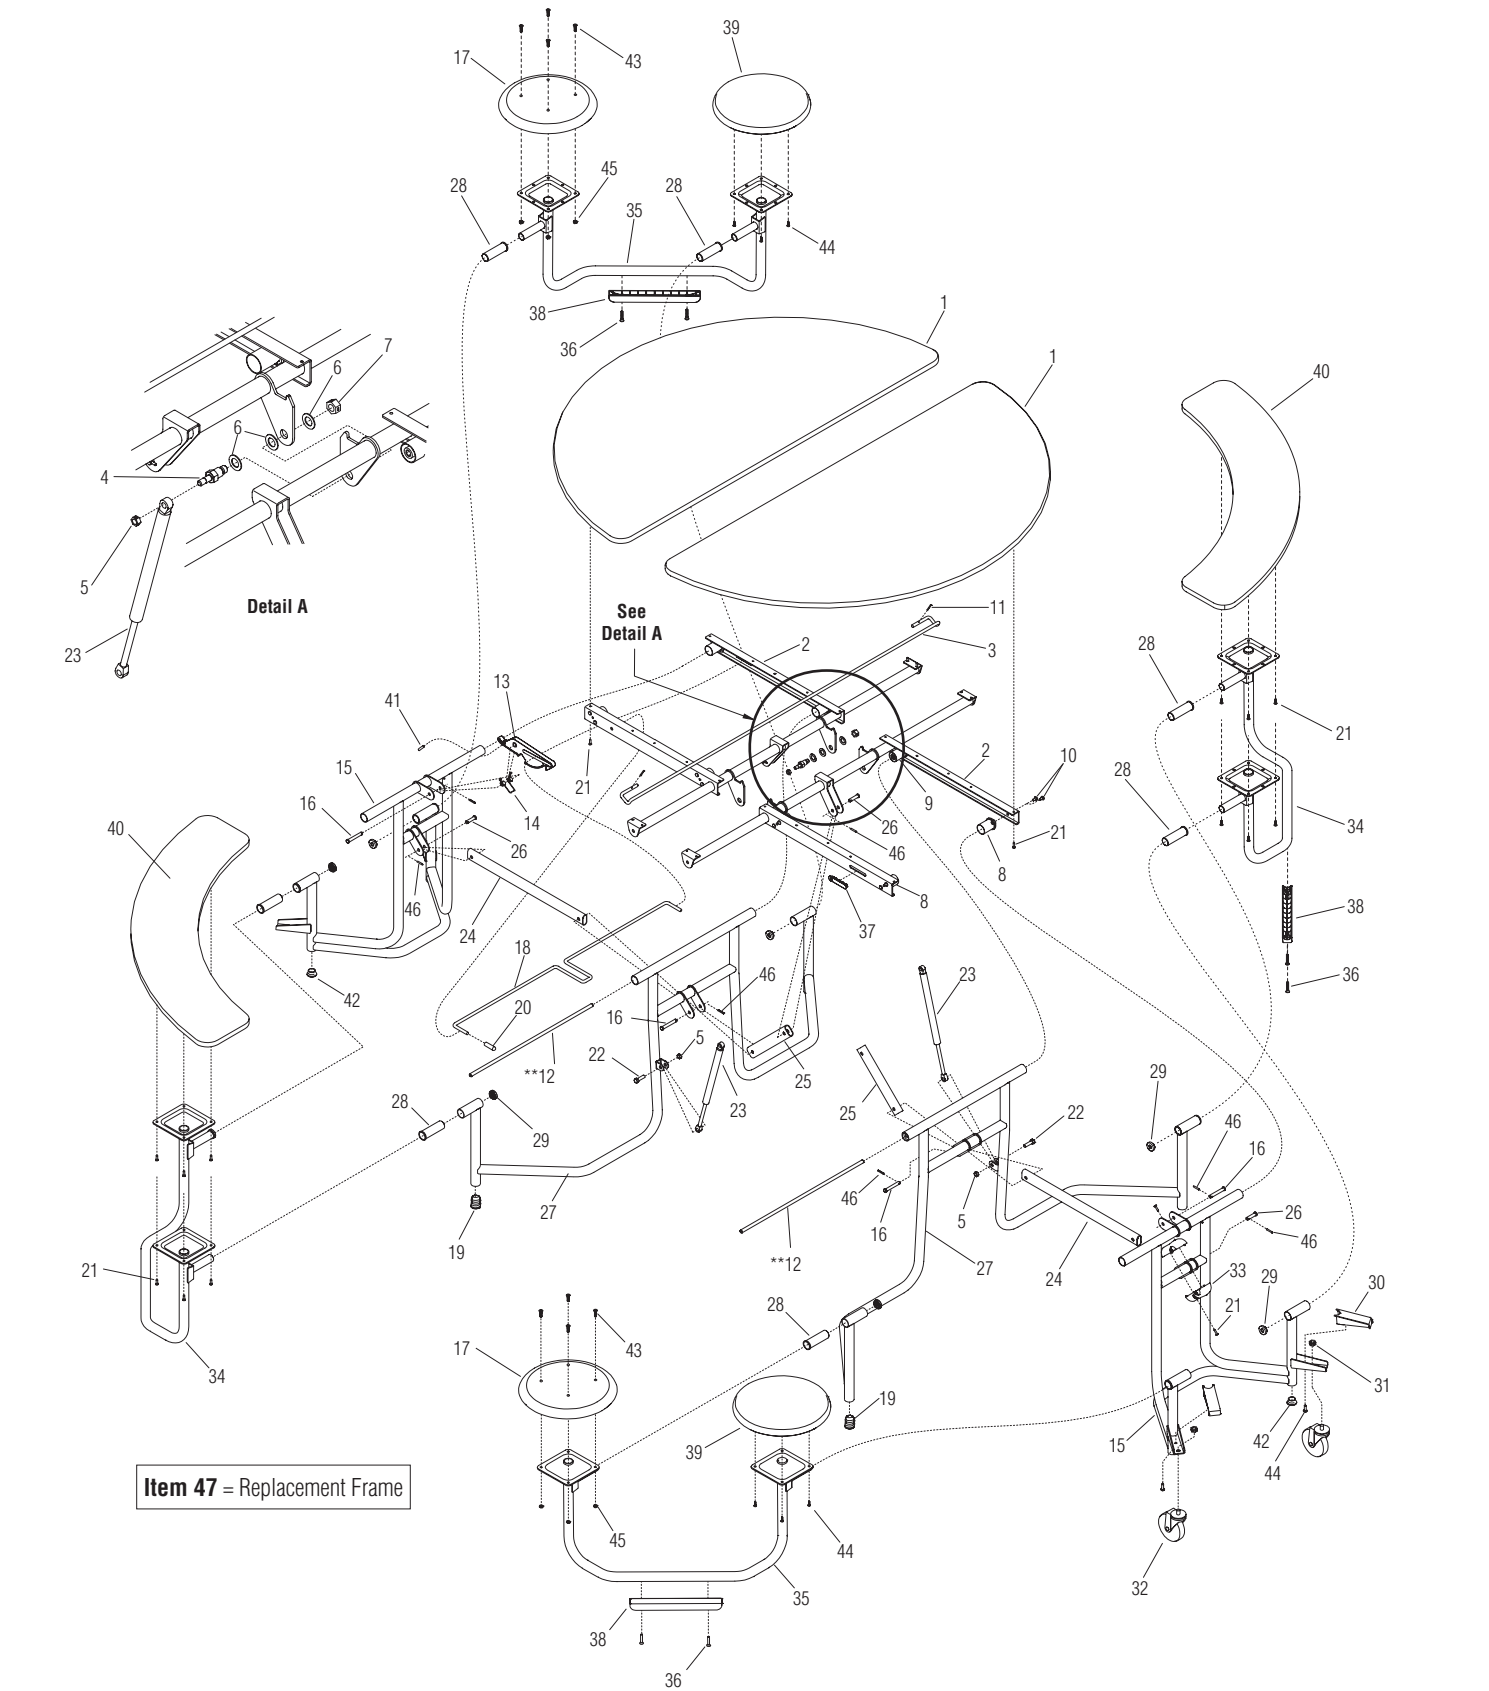

Uniframe Tables - Parts Diagram

Round Table with Seats - UFRD 5/8, UFRD 5/SB

When ordering specify laminate color and edge style.


“.XX” = Select Color & “.XXX” = Select Color and an X. Example: Black is .BLX

** = (2) Torsion bars per table located in center leg weldments.

34 = When standing in front of the seam (space between the two half tops) the left is on the left (Detail B).


35 = When standing in front of the seam (space between the two half tops) the right is on the right (Detail B).

Item	Part Number	Item Description	Req Qty
1	UFATO	Table Top, 5' Round, Bullnose	2
		Table Top, 5' Round, Perfect Edge	2
		Table Top, 5' Round, 73P Edge	2
2	37.3383.BL.X	Apron Weldment	2
3	37.3391.CH.X	Down Lock	1
4	37.3360.X	Center Pivot	2
5	12.1153.X	Nut, $\frac{3}{8}$ " Center Lock	4
6	12.2700.X	Washer, Thrust	6
7	12.7000.X	Flange Lock Nut, $\frac{1}{2}$ "-13	2
8	37.3332.BL.X	Pivot Hub Weldment	6
9	37.3331.BL.X	Torque Flange Weldment	2
10	49.1612.P.X	Screw, $\frac{1}{4}$ -20 x $\frac{5}{8}$ " Serrated Hex Head	16
11	12.1943.X	Roll Pin, $\frac{1}{8}$ x $1\frac{1}{4}$ "	2
**12	37.3344.X	Torsion Bar	2
13	37.3388.X	Latch, Spider	1
14	37.3346.X	Latch Spring	1
15	37.3376.27.XXX	End Leg Weldment, 27"	2
	37.3376.29.XXX	End Leg Weldment, 29"	2
16	12.2703.X	Clevis Pin, $\frac{3}{8}$ x $2\frac{1}{2}$ "	4
17	06.1005.MBE.DRX	Hard Plastic Stool, Beige #02	8
	06.1005.CB.DRX	Hard Plastic Stool, Blue #07	8
	06.1005.CN.DRX	Hard Plastic Stool, Navy #25	8
	06.1005.CL.DRX	Hard Plastic Stool, Light Grey #16	8
	06.1005.CBLDR.X	Hard Plastic Stool, Black	8
	06.1005.CR.DRX	Hard Plastic Stool, Cranberry #13	8
18	37.3403.CH.X	Latch Actuator Rod	1
19	37.3401.X	Center Glide UFRD	4
20	37.3408.X	Actuator Rod End Cap	2
21	12.0039.X	Screw, #10 x $\frac{3}{4}$ " PH DPthread	28
		Screw, #10 x $\frac{3}{4}$ " PH DPthread for Spider Bench	64
22	12.1100.X	Bolt, $\frac{3}{8}$ x $1\frac{1}{4}$ " Hex Head	2
23	37.3356.X	Pneumatic Cylinder, 40# force	2
24	37.3338.S.X	Spider Linkage	2
25	37.3338.C.X	Linkage	2
26	12.2704.X	Clevis Pin, $\frac{3}{8}$ x $1\frac{1}{2}$ "	4
27	37.3375.27.XXX	Center Leg Weldment, 27"	2
	37.3375.29.XXX	Center Leg Weldment, 29"	2
28	37.3336.BL.X	Pivot Bushing, Seat	4
29	10.1009.X	Double Clip Tube Closure (chrome supports)	8
30	37.3398.X	Cover, Caster Bracket	4
31	12.2711.X	Nut, $\frac{7}{16}$ -14 Center Lock	4
32	09.1022.X	4" Swivel Caster, $\frac{5}{8}$ " Stem	4
33	37.3392.X	Cover, Knee Protection	4
34	37.3381.L.XXX	Seat Support Spider, Left-hand	2
35	37.3381.R.XXX	Seat Support Spider, Right-hand	2
36	12.2709.X	Screw, $\frac{1}{2}$ -20 x 1.5" Thread Cutting	8
37	37.3405.X	Slot Plug	2
38	37.3400.X	12" Glide	4
39	06.1089.XX	Stool, Poly	8
40	UFAFE	Split Bench For Spider, Bullnose Edge	4
		Split Bench For Spider, Perfect Edge	4
		Split Bench For Spider, 73P Edge	4
41	12.2713.X	Set Screw, $\frac{1}{4}$ -20 x 1"	1
42	06.0416.X	Tube Plug, $1\frac{1}{4}$ " dia, 14-20ga BL	4
43	12.1953.X	Carriage Bolt, $\frac{3}{16}$ x 1" (hard plastic stool only)	32
44	12.1200.X	Screw, SMS #14 x $\frac{5}{8}$ " PPH (poly stool only)	64
45	12.0023.TM.X	Hex Nut w/washer, #10-24 (hard plastic stool only)	32
46	12.1004.TM.X	Roll Pin, $\frac{5}{32}$ x 1"	8
47	UFAFR	Replacement Frame (Doesn't include tops, seats or benches. Includes casters, cylinders, glides & aprons.)	1

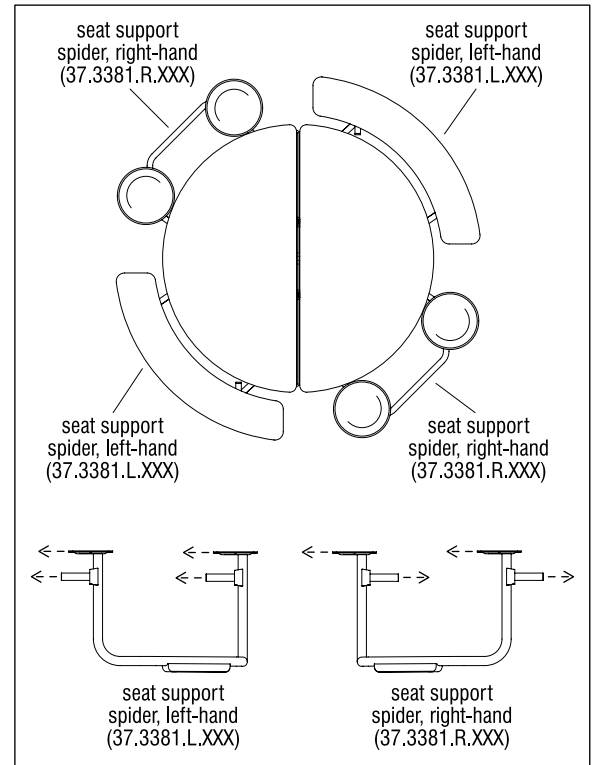

Detail B - Item Numbers 34 & 35 Identification

■ **Uniframe Tables - Parts Diagram**
Shaped Tables without Seats - UFRD

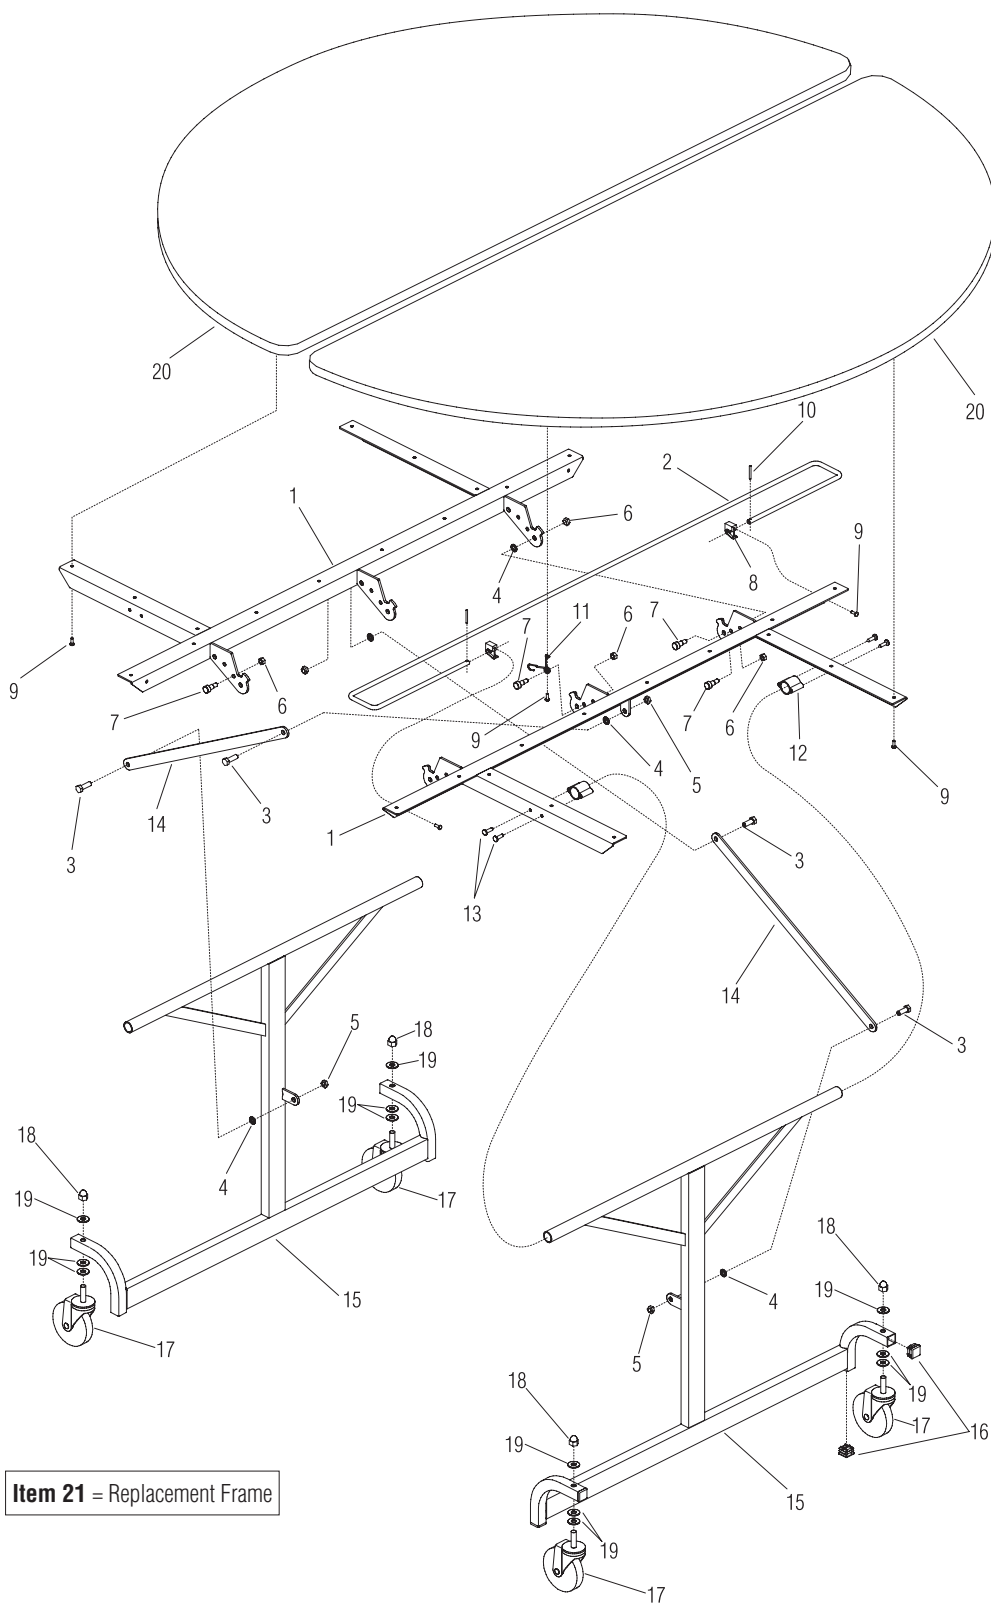


When ordering specify laminate color and edge style.

“.XX” = Select Color & “.XXX” = Select Color

Item	Part Number	Item Description	Req Qty
1	37.3130.48.BLX	Apron Weldment, 48" Tables	2
	37.3130.60.BLX	Apron Weldment, 60" and Larger Tables	2
2	45.1580.1.CHX	Down Lock, 48" Tables	1
	45.1580.2.CHX	Down Lock, 60" Tables	1
	45.1580.3.CHX	Down Lock, 72" Tables	1
3	12.1027.TM.X	Bolt, $\frac{3}{8}$ "-16 x $\frac{3}{4}$ " HHCS	4
4	12.1151.X	Thrust Washer, $\frac{3}{8}$ "	11
5	12.1153.X	Nut, $\frac{3}{8}$ " Center Lock	4
6	12.1154.X	Nut, $\frac{5}{16}$ "-18 Flanged Center Lock	7
7	12.1150.X	Bolt, $\frac{3}{8}$ x $\frac{1}{2}$ " Socket Head Shoulder	7
8	06.0750.X	Down Lock Pivot	2
9	12.0039.X	Screw, #10 x $\frac{3}{4}$ " Ph Dp Thread	31
10	12.1943.X	Roll Pin, $\frac{1}{8}$ x $\frac{1}{4}$ "	2
11	45.1551.X	Spring, $\frac{3}{8}$ " RF Downlock	1
12	37.3107.X	Leg Pivot, Extruded Aluminum	4
13	12.2712.X	Taptite Screw, #12-24 x $\frac{1}{2}$ ", PPH	8
14	37.3102.BL.X	Fold Linkage	2
15	37.3150.27.XXX	Narrow T-Leg Weldment, 27" (48" tables)	2
	37.3150.29.XXX	Narrow T-Leg Weldment, 29" (48" tables)	2
	37.3150.31.XXX	Narrow T-Leg Weldment, 31" (48" tables)	2
	37.3150.42.XXX	Narrow T-Leg Weldment, 42" (48" tables)	2
	37.3152.27.XXX	Wide T-Leg Weldment, 27" (60" and larger tables)	2
	37.3152.29.XXX	Wide T-Leg Weldment, 29" (60" and larger tables)	2
	37.3152.31.XXX	Wide T-Leg Weldment, 31" (60" and larger tables)	2
	37.3152.42.XXX	Wide T-Leg Weldment, 42" (60" and larger tables)	2
16	06.0434.X	Plug, 1" Square Tube	8
17	09.1040.X	Caster, 4" Swivel 1 $\frac{1}{2}$ " Stem	4
18	12.3701.X	Capnut, $\frac{7}{16}$ "-14	4
19	12.0185.X	Washer, Flat	12
20	UFATO	Table Top, 4' Round, Bullnose	2
		Table Top, 4' Round, Perfect Edge	2
		Table Top, 4' Round, 73P Edge	2
		Table Top, 5' Round, Bullnose	2
		Table Top, 5' Round, Perfect Edge	2
		Table Top, 5' Round, 73P Edge	2
		Table Top, 6' Round, Bullnose	2
		Table Top, 6' Round, Perfect Edge	2
		Table Top, 6' Round, 73P Edge	2
		Table Top, 4' Square, Bullnose	2
		Table Top, 4' Square, Perfect Edge	2
		Table Top, 4' Square, 73P Edge	2
		Table Top, 4' Hexagobal, Bullnose	2
		Table Top, 4' Hexagobal, Perfect Edge	2
		Table Top, 4' Hexagobal, 73P Edge	2
		Table Top, 5' Octagonal, Bullnose	2
		Table Top, 5' Octagonal, Perfect Edge	2
		Table Top, 5' Octagonal, 73P Edge	2
		Table Top, 60 x 66" Oval, Bullnose	2
		Table Top, 60 x 66" Oval, Perfect Edge	2
		Table Top, 60 x 66" Oval, 73P Edge	2
		Table Top, 60 x 72" Oval, Bullnose	2
		Table Top, 60 x 72" Oval, Perfect Edge	2
		Table Top, 60 x 72" Oval, 73P Edge	2
21	UFAFR	Replacement Frame (Doesn't include tops, seats or benches. Includes casters, cylinders, glides & aprons.)	1

■ **Uniframe Tables - Parts Diagram**
 Rectangular Table without Seats - UFRT

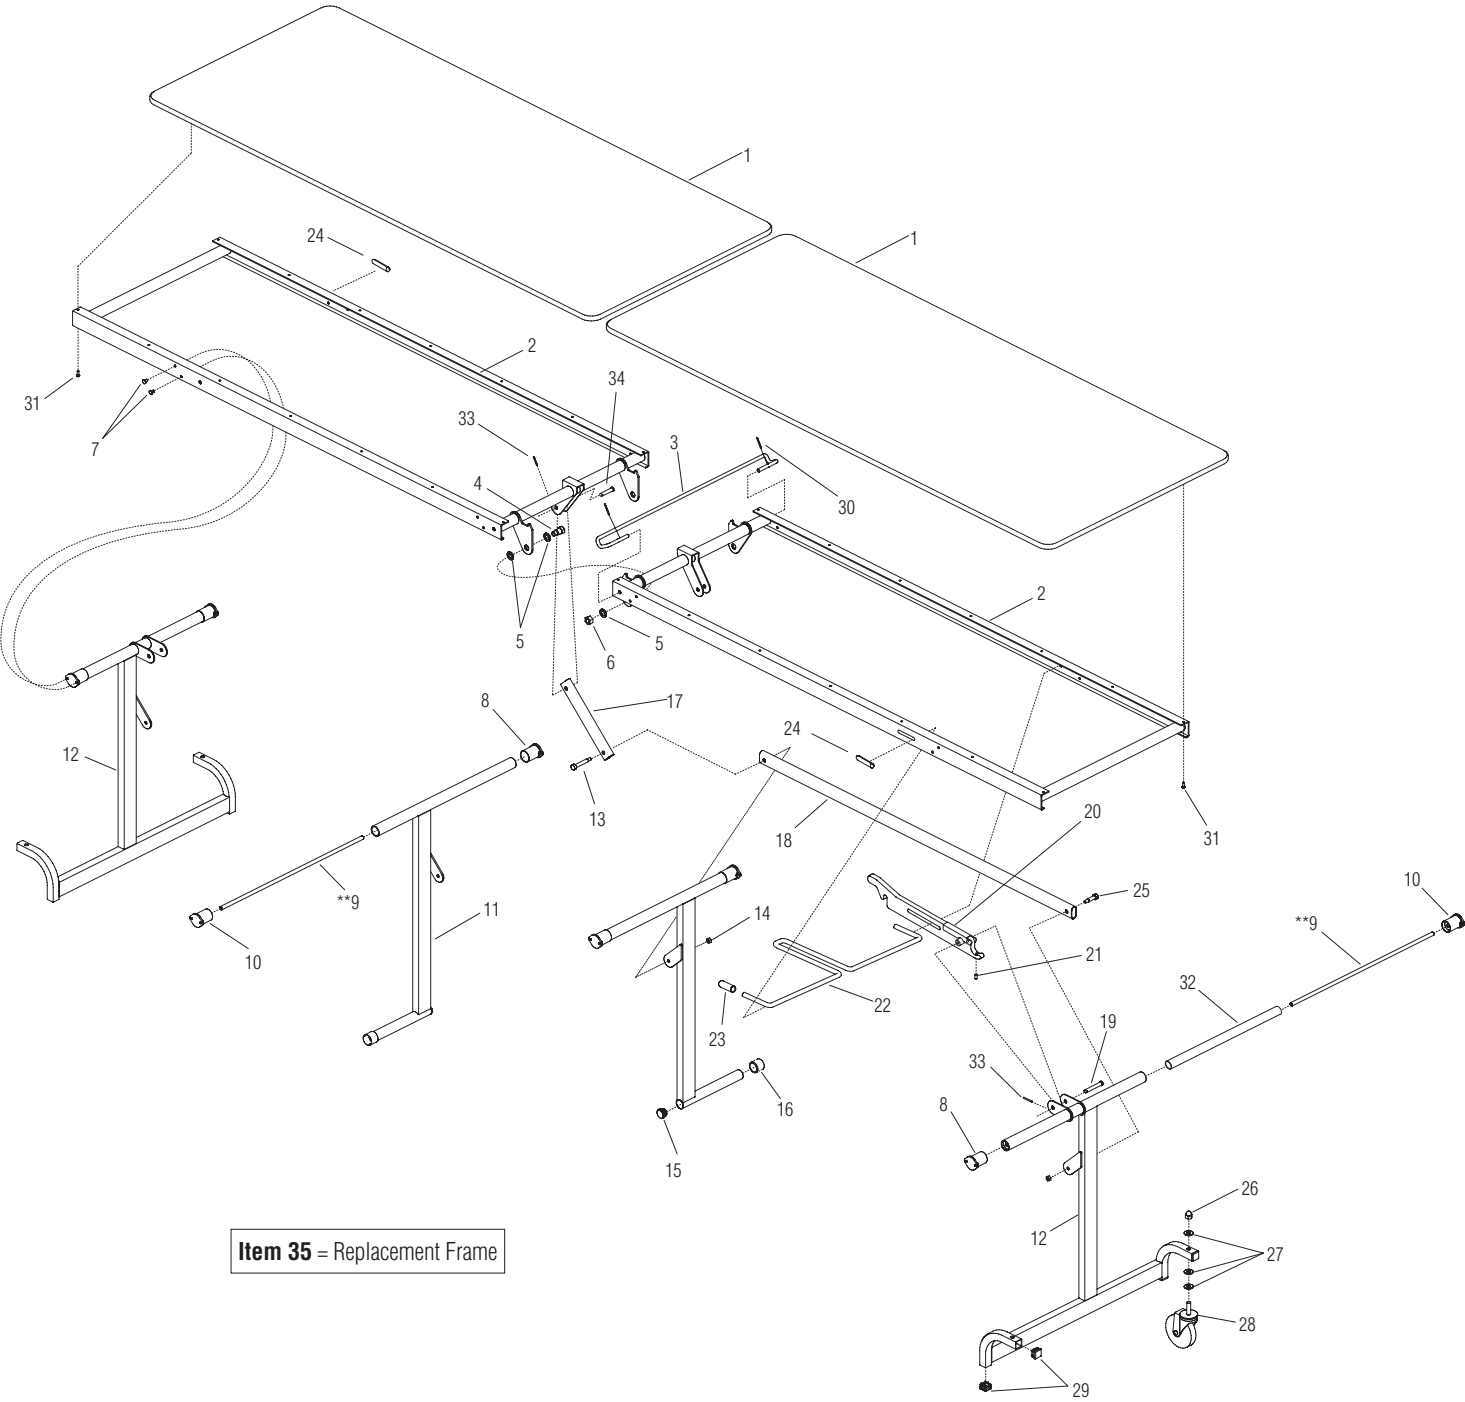

Uniframe Tables - Parts Diagram ■ Rectangular Table without Seats - UFRT & WAUFRT

When ordering specify laminate color and edge style.

".XX" = Select Color & ".XXX" = Select Color

** = UFRT08 uses (2) Torsion Bars located in the Outside Support Weldments.
UFRT10 uses (3) Torsion Bars, (1) located in a Center and (2) Outer support weldments.
UFRT12 uses (4) Torsion Bars (1) in all support weldments.

Item	Part Number	Item Description	Req Qty
1	UFATO	Table Top, 30 x 48" Bullnose	2
		Table Top, 30 x 48" Perfect Edge	2
		Table Top, 30 x 48" 73P Edge	2
		Table Top, 30 x 60" Bullnose	2
		Table Top, 30 x 60" Perfect Edge	2
		Table Top, 30 x 60" 73P Edge	2
		Table Top, 30 x 72" Bullnose	2
		Table Top, 30 x 72" Perfect Edge	2
		Table Top, 30 x 72" 73P Edge	2
2	37.3307.12.BLX	Apron Weldment, 12'	2
	37.3307.10.BLX	Apron Weldment, 10'	2
	37.3307.8.BLX	Apron Weldment, 8'	2
3	37.3337.CH.X	Down Lock	1
4	37.3368.X	Center Pivot, w/o 3/8 x 1" Stud	2
5	12.2700.X	Washer, Thrust	6
6	12.7000.X	Flange Lock Nut, 1/2-13	2
7	49.1612.P.X	Screw, 1/4-20 x 5/8" Serrated Hex Head	16
8	37.3332.BL.X	Pivot Weldment, 8'	6
		Pivot Weldment, 10'	5
		Pivot Weldment, 12'	4
**9	37.3344.X	Torsion Bar, 8'	2
		Torsion Bar, 10'	3
		Torsion Bar, 12'	4
10	37.3331.BL.X	Torque Flange Weldment, 8'	2
		Torque Flange Weldment, 10'	3
		Torque Flange Weldment, 12'	4
11	37.3300.27.XXX	Support Weldment, 27, Center, UFRT	2
	37.3300.29.XXX	Support Weldment, 29, Center, UFRT	2
	37.3300.31.XXX	Support Weldment, 31, Center, WAUFRT	2
12	37.3301.27.XXX	Support Weldment, 27, Outside, UFRT	2
	37.3301.29.XXX	Support Weldment, 29, Outside, UFRT	2
	37.3301.31.XXX	Support Weldment, 31, Outside, WAUFRT	2
13	12.2702.X	Bolt, 3/8 x 2" Socket Head Shoulder	2
14	12.1154.X	Nut, 5/16"-18 Flanger Center Lock	4
15	53.6560.BL.X	Plug, 1" Blk	2
16	06.0018.TM.X	Cap Glide	2
17	37.3338.C.BL.X	Center Linkage	2
18	37.3338.12.O.BL	Outside Linkage, 12', UFRT 12	2
	37.3338.10.O.BL	Outside Linkage, 10', UFRT 10	2
	37.3338.8.O.BL	Outside Linkage, 8', UFRT 08	2
19	12.2703.X	Clevis Pin, 3/8 x 2 1/2"	2
20	37.3366.BL.X	Latch, with Catch, UFRT Models	1
21	12.2713.X	Set Screw, 1/4-20 x 1"	1
22	37.3404.CH.X	Latch Actuator Rod	1
23	37.3408.X	End Cap	2
24	37.3405.X	Slot Plug	2
25	12.2701.X	Bolt, 3/8 x 1" Socket Head Shoulder	2
26	12.3701.X	Capnut, 7/16-14	4
27	12.0185.X	Washer, Flat	12
28	09.1040.X	4" Swivel Caster, 1 1/2" Stem	4
29	06.0434.X	Plug, 1" Square Poly	8
30	12.1943.X	Roll Pin, 1/8 x 1 1/4"	2
31	12.0039.X	Screw, #10 x 3/4" PH DP thread, 8'	20
		Screw, #10 x 3/4" PH DP thread, 10'	24
		Screw, #10 x 3/4" PH DP thread, 12'	28
32	37.3399	Inner Tube, 1 x 20 1/2" (used in outside supports only)	2
33	12.1004.TM.X	Roll Pin, 5/32 x 1"	4
34	12.2704.X	Clevis Pin, 3/8 x 1 1/2"	2
35	UFAFR	Replacement Frame (Doesn't include tops, seats or benches. Includes casters, cylinders, glides & aprons.)	1

KI
1330 Bellevue Street
Green Bay, Wisconsin 54302
1-800-424-2432
www.ki.com

KI is a registered trademark
of Krueger International, Inc.

© 2023 Krueger International, Inc.
All Rights Reserved
Code KI-60763R14/KI/PDF/0923

