


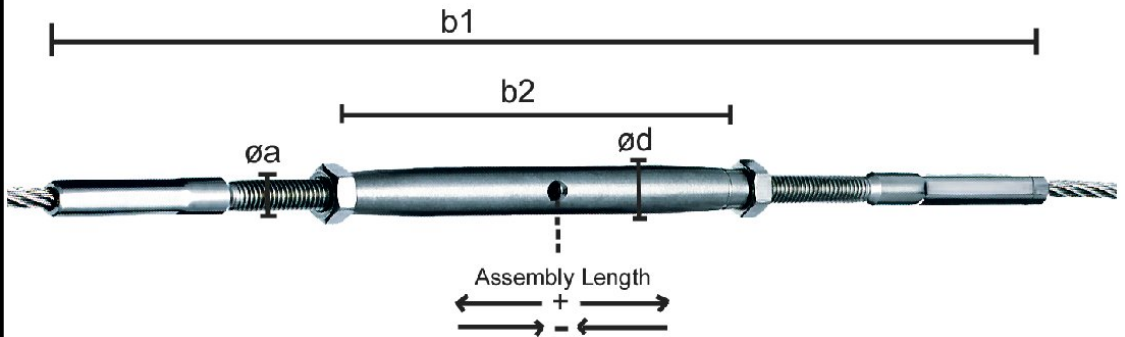

TURNBUCKLE SWAGE/SWAGE

Part number	ø Rope in mm	a in mm	b1	b2	ød	+	-
829-0200-01	2	M5	166	80	8.0	16	26
829-0200-02	2	M5	211	80	8.0	30	40
829-0300-01	3	M6	207	92	10.0	14	26
829-0300-02	3	M6	250	92	10.0	32	44
829-0400-01	4	M6	217	92	10.0	14	26
829-0400-02	4	M6	260	92	10.0	32	44
829-0400-03	4	M8	270	112	13.5	38	54
829-0500-01	5	M8	248	112	13.5	8	24
829-0500-02	5	M8	280	112	13.5	38	54
829-0600-01	6	M10	314	120	17.2	30	50
829-0600-02	6	M10	340	120	17.2	40	60
829-0800-01	8	M12	425	150	21.3	46	70
829-1000-01	10	M16	560	190	26.9	62	94
829-1200-01	12	M20	646	220	33.7	70	110
829-1600-01	16	M24	858	328	50.0	92	140

AISI 316 Breaking strength: 90% of rope Max. Breaking Load

+/- is the starting position for the tensioner. External thread swages

right/left hand allow the turnbuckle to be turned altering the cable length.

Minimum thread engagement recommended as 1.5 X thread size -ø

(M8=12mm). + = less tension, - = more tension.



e-mail: sales@decorcable.com

Toll Free: (800)444-6271

© Copyright 2005 Carl Stahl DécorCable