
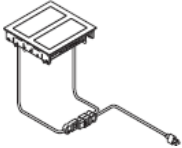


Top Specification:

Power unit fits with tops of this size:


- Range of top width: 84" - 114"
- Number of bases: 2 Bases
- 10' Power infeed cord provides sufficient length to route through end base.
- Top power one location cutout CF1C

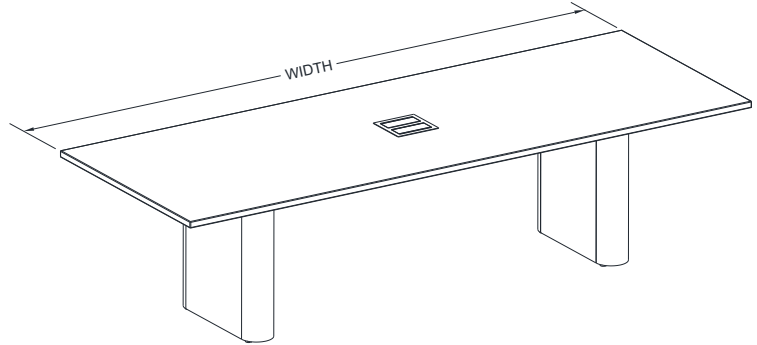


M2X 9PCF42K1C Pattern 1-unit kit

Kit Content: item (quantity)


- M2X power units (1)
- Power infeed - 15 amp plug (1)
- Splitter - grey (1)
- Cable mounting clips (10)
- #6 x 5/8" mounting screws (20)

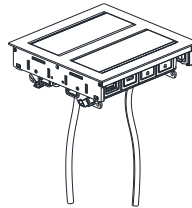

M2X Power Unit

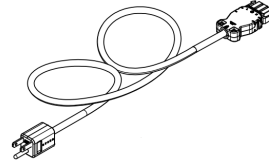


Power Infeed

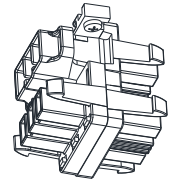

Splitter

Tools Required:

- #2 Phillips Head 
- Drill 

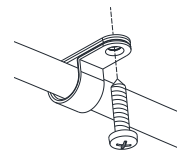

Cable Mounting Clip




Mounting Screw

Connection Type


NOTE: Splitter must be used to connect cords

Splitter


TOP

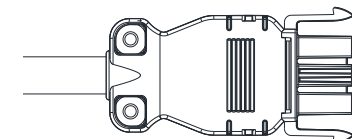

Male Connection

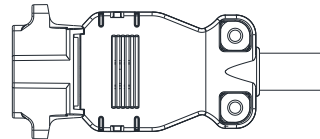


Female Connection

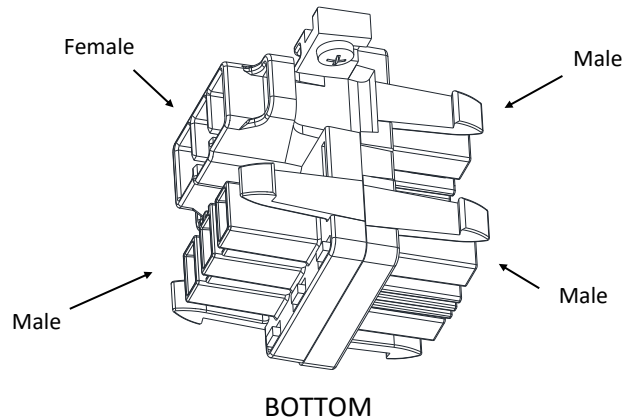


BOTTOM

Step 1 - M2X installation to top


1. Attach 1 clip, at each end of unit base with short leg of clip sliding into recess.
2. Route M2X unit connection cords through top cutout as power unit is lowered into opening. As unit is pushed into the opening the clips will grip the top material wall.
3. Select adapter or blank cover for unit open window.
The 12-pack data adapter kit has been provided with unit to support a variety of connection options.

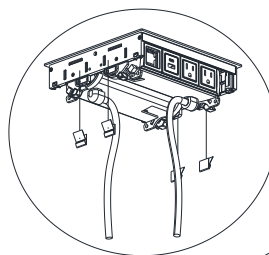

Detail 1

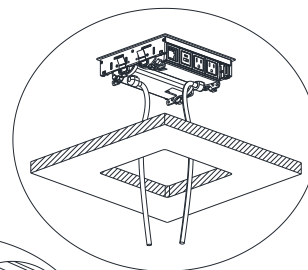

Detail 2

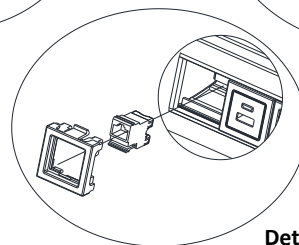

Detail 3

M2X - Power Connection - End Location Infeed


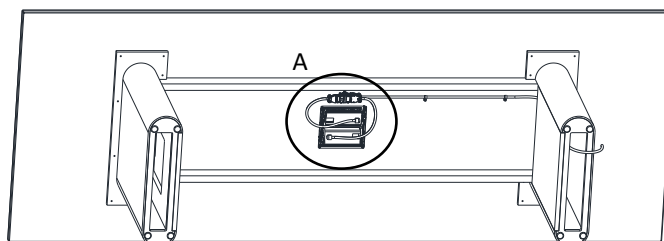



Table Diagram

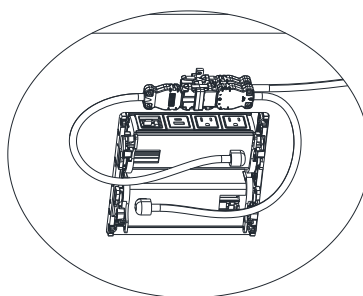

Detail A

Step 2 - Connecting M2X unit to power - End Location Infeed



1. Insert infeed male connector into splitter female connection.
2. Insert unit female connectors onto splitter male connections below infeed.
3. Insert unit female connector onto splitter bottom male connection opposite infeed

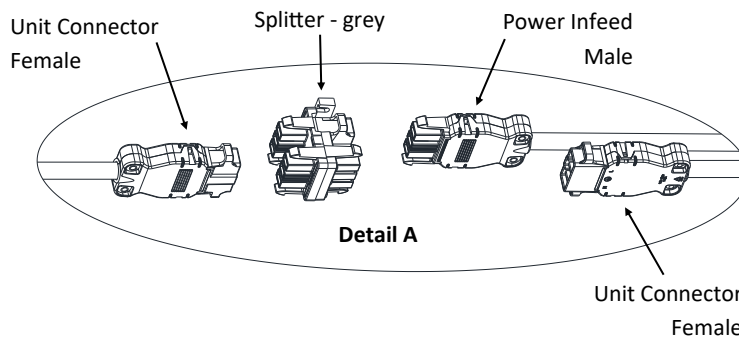

Detail A

Securing Connections and Cables

2. Position splitters to allow cables to route under top freely and install (2) #6 x 5/8" mounting screws to secure, do not over tighten as could damage splitter.
3. Install cable mounting clips along cables spacing no more than 18" apart with #6 x 5/8" mounting screws to secure unit and jumper cables.

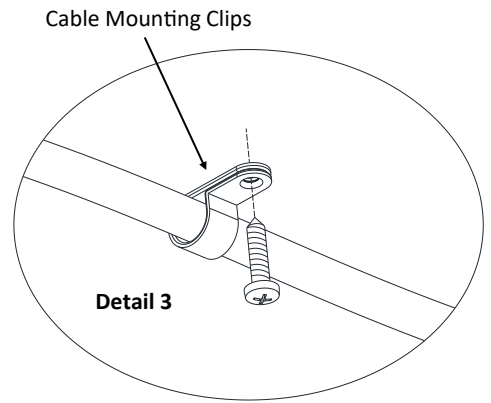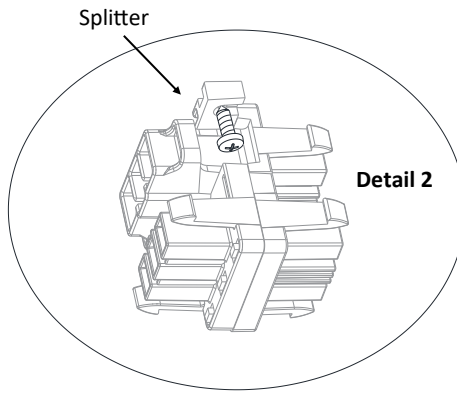

Power Infeed Connection

1. Use cable clips to route the cord through the channel to the floor outlet. Secure excess cord in the vertical channel or to the table with clips.
2. Plug power infeed into building power source and check unit outlets to verify power.

